
## CTM SUBDIVISION

A PART OF THE N.E. 1/4 OF SEC. 7, & THE S.E. 1/4 OF SEC. 6, T. 7 N., R. 1 E., S.L.B. & M. WEBER COUNTY, UTAH

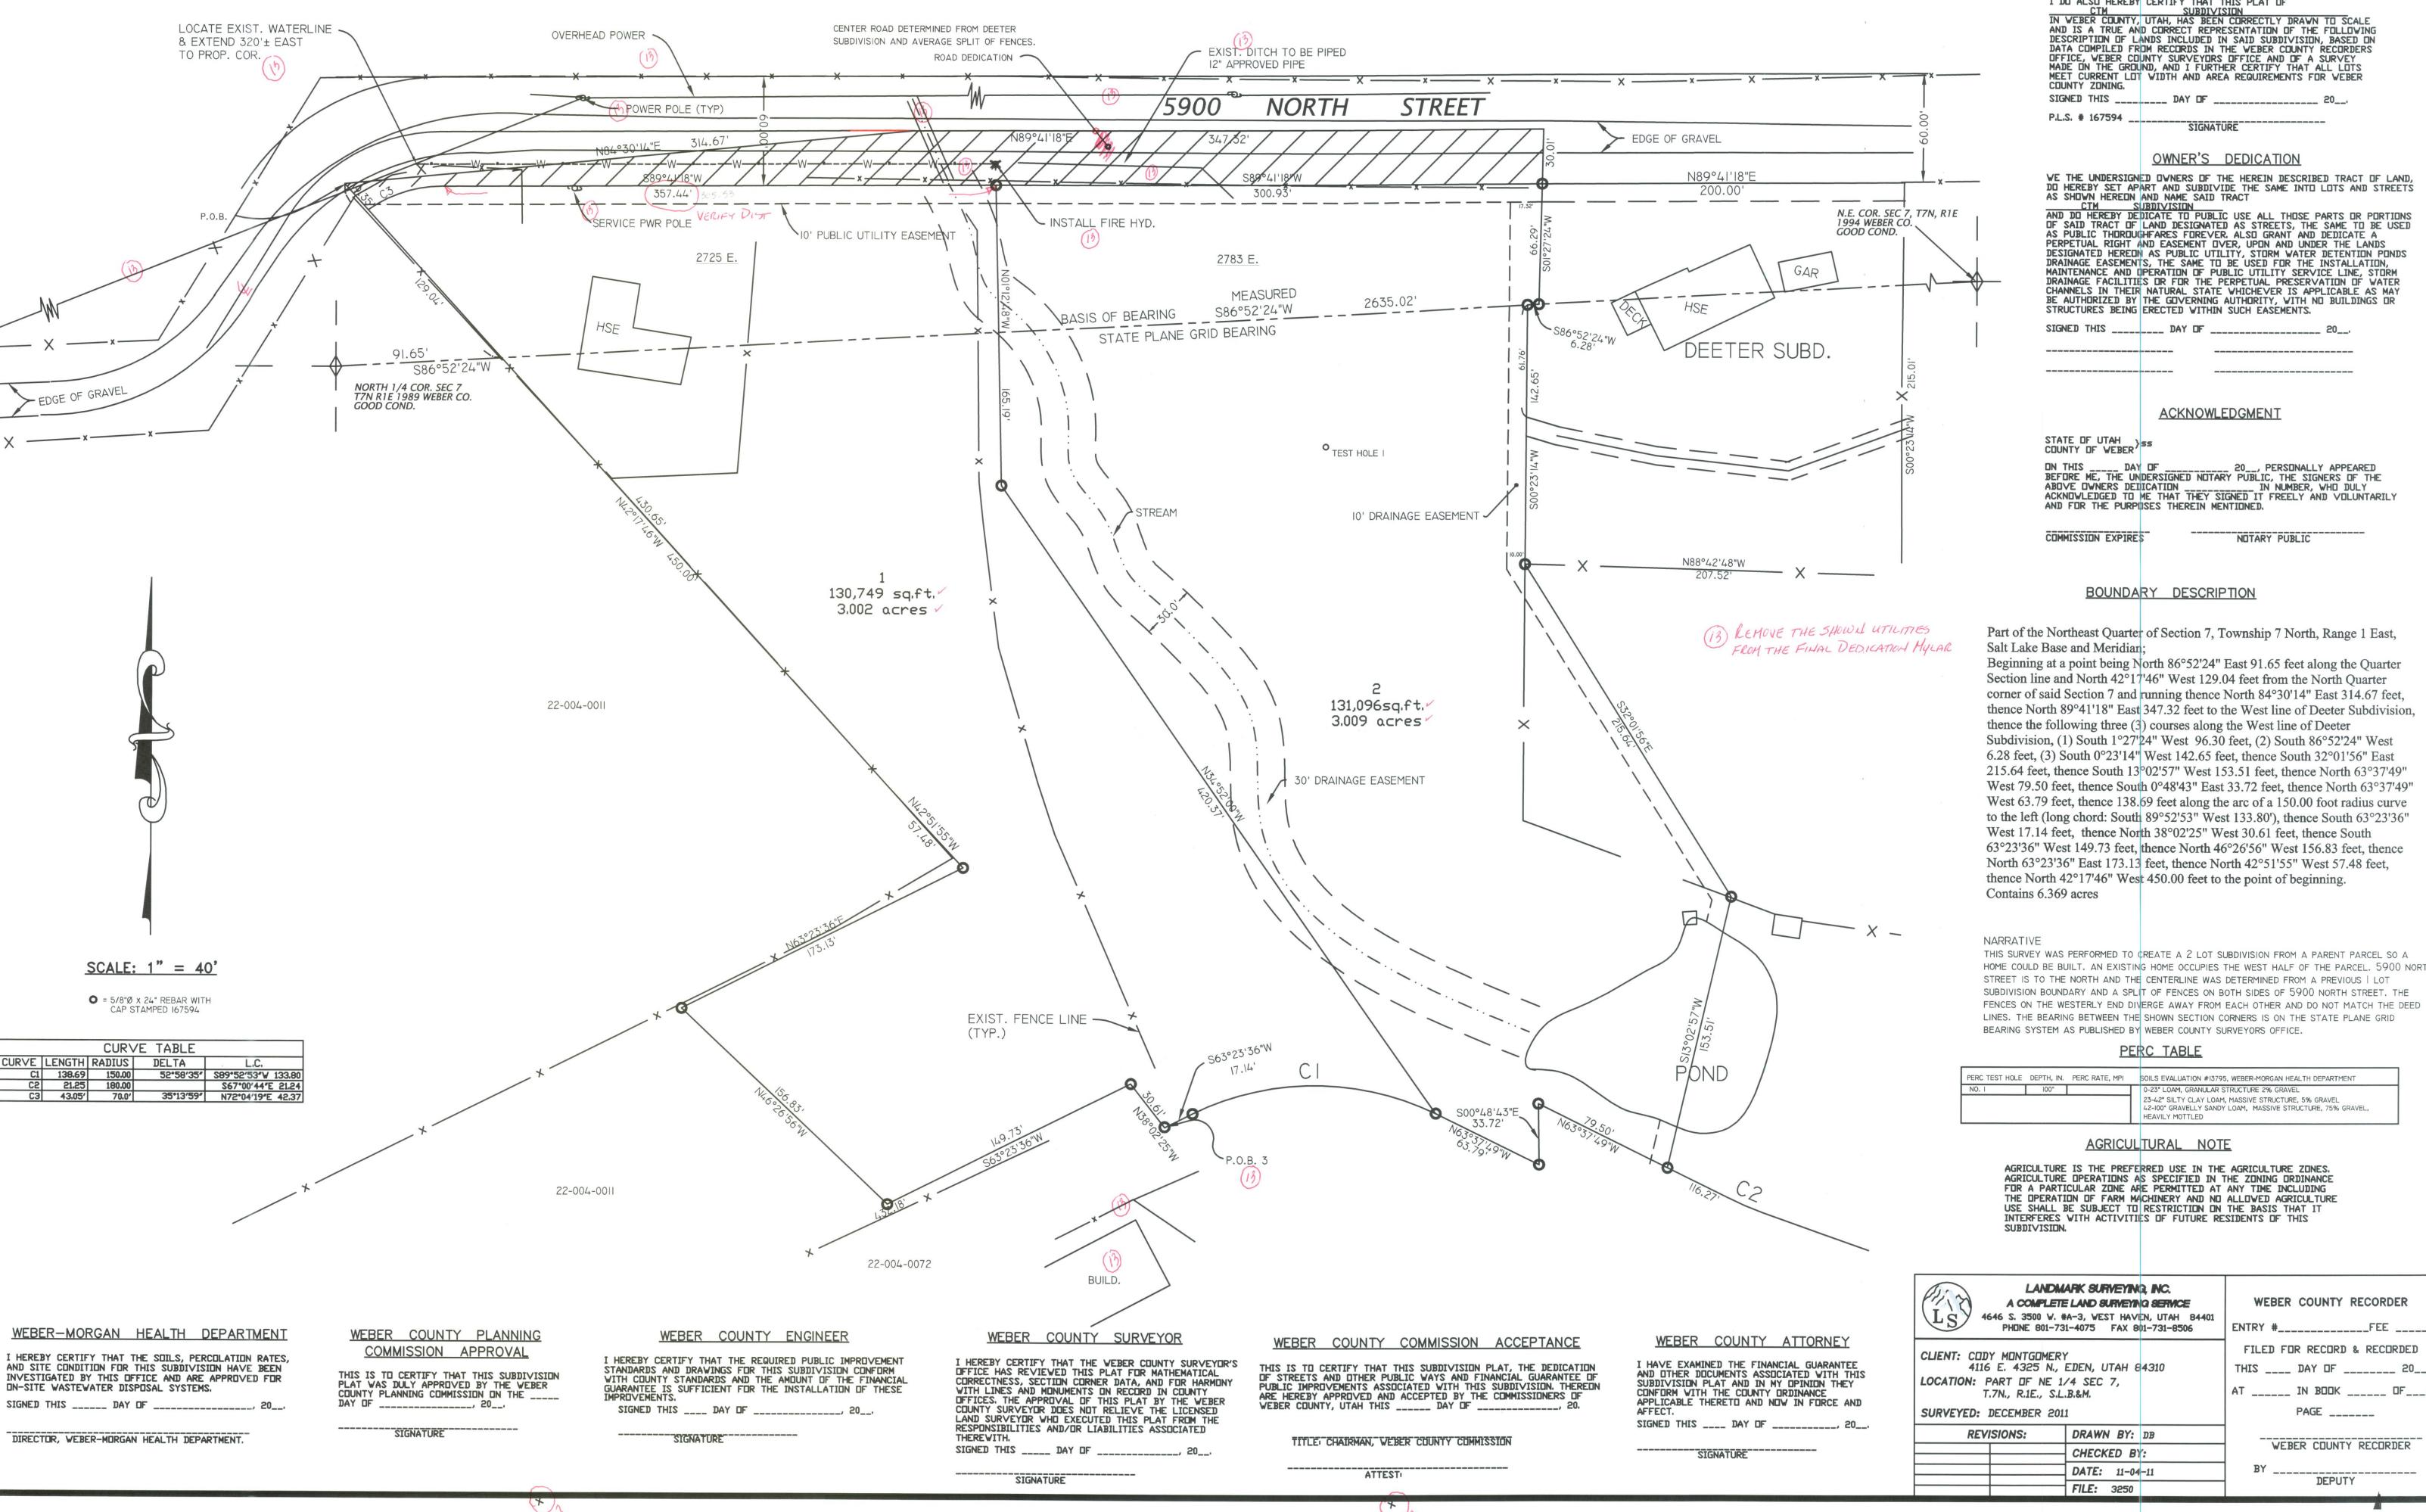

## SURVEYOR'S CERTIFICATE

I DALLAS K. BUTTARS, HOLDING LICENSE NUMBER 167594 IN ACCORDANCE WITH TITLE 58, CHAPTER 22, PROFESSIONAL ENGINEERS AND LAND SURVEYORS LICENSING ACT, HAVE COMPLETED A SURVEY OF THE PROPERTY DESCRIBED ON THE PLAT IN ACCORDANCE WITH SECTION 17-23-17 AND HAVE VERIFIED ALL MEASUREMENTS AND PLACED MONUMENTS AS REPRESENTED ON THE PLAT. I DO ALSO HEREBY CERTIFY THAT THIS PLAT OF

SIGNED	ZIHT	 	DAY	OF	 20
		 	-		 

Part of the Northeast Quarter of Section 7, Township 7 North, Range 1 East,

Beginning at a point being North 86°52'24" East 91.65 feet along the Quarter Section line and North 42°17'46" West 129.04 feet from the North Quarter corner of said Section 7 and running thence North 84°30'14" East 314.67 feet. thence North 89°41'18" East 347.32 feet to the West line of Deeter Subdivision, thence the following three (3) courses along the West line of Deeter Subdivision, (1) South 1°27'24" West 96.30 feet, (2) South 86°52'24" West 6.28 feet, (3) South 0°23'14" West 142.65 feet, thence South 32°01'56" East 215.64 feet, thence South 13 02'57" West 153.51 feet, thence North 63°37'49" West 79.50 feet, thence South 0°48'43" East 33.72 feet, thence North 63°37'49" West 63.79 feet, thence 138.69 feet along the arc of a 150.00 foot radius curve to the left (long chord: South 89°52'53" West 133.80'), thence South 63°23'36" West 17.14 feet, thence North 38°02'25" West 30.61 feet, thence South 63°23'36" West 149.73 feet, thence North 46°26'56" West 156.83 feet, thence North 63°23'36" East 173.13 feet, thence North 42°51'55" West 57.48 feet, thence North 42°17'46" West 450.00 feet to the point of beginning.

THIS SURVEY WAS PERFORMED TO CREATE A 2 LOT SUBDIVISION FROM A PARENT PARCEL SO A HOME COULD BE BUILT, AN EXISTING HOME OCCUPIES THE WEST HALF OF THE PARCEL. 5900 NORTH STREET IS TO THE NORTH AND THE CENTERLINE WAS DETERMINED FROM A PREVIOUS | LOT SUBDIVISION BOUNDARY AND A SPLIT OF FENCES ON BOTH SIDES OF 5900 NORTH STREET. THE FENCES ON THE WESTERLY END DIVERGE AWAY FROM EACH OTHER AND DO NOT MATCH THE DEED LINES, THE BEARING BETWEEN THE SHOWN SECTION CORNERS IS ON THE STATE PLANE GRID

PERC TEST HOLE	DEPTH, IN.	PERC RATE, MPI		SOILS EVALUATION #13795, WEBER-MORGAN HEALTH DEPARTMENT
NO. I	100"		Г	0-23" LOAM, GRANULAR STRUCTURE 2% GRAVEL
			23-42" SILTY CLAY LOAM, MASSIVE STRUCTURE, 5% GRAVEL 42-100" GRAVELLY SANDY LOAM, MASSIVE STRUCTURE, 75% GRAVEL, HEAVILY MOTTLED	

A COMPLETE 4646 S. 3500 W. #	ARK <b>SURVEYIN</b> ELAND SURVEYIN A-3, WEST HAVI 1-4075 FAX 8	IG SERVICE EN, UTAH 84401	WEBER COUNTY RECORDER ENTRY #FEE	
CLIENT: CODY MONTGOMERY 4116 E. 4325 N., LOCATION: PART OF NE 1, T.7N., R.1E., S.L. SURVEYED: DECEMBER 201	EDEN, UTAH 8 /4 SEC 7, .B.&M.	4310	FILED FOR RECORD & RECORDED  THIS DAY OF 20  AT IN BOOK OF  PAGE	
REVISIONS:	DRAWN BY:	DB		
	CHECKED BY	<b>/:</b>	WEBER COUNTY RECORDER	
	DATE: 11-04	-11	BY DEPUTY	