

ASSY. PIN VY3093A (10' SECTION) FOR 1 1/2" - 2 1/2" BRACE

ITEM	QTY.	PART NO.	DESCRIPTION	DWG. NO.
1	1	NL10	10'-0" LADDER SECTION	SK480905
2	2	KY95	LADDER SPICE PLATE	SK480905
3	2	VY3040	LADDER SUPPORT TUBE	B820864
4	4	Z10018GA	1/2" x 1 1/2" BOLT ASSY.	CT10404
5	12	J44AA	3/8" J-BOLT ASSY.	B2942A
6	4	KH91	SADDLE CLAMP	B10214
7	2	H173	LADDER CLIP	B820993

ASSY. PIN VY3093A (20' SECTION) FOR 1 1/2" - 2 1/2" BRACE

ITEM	QTY.	PART NO.	DESCRIPTION	DWG. NO.
1	1	NL20	20'-0" LADDER SECTION	SK480905
2	2	KY95	LADDER SPICE PLATE	SK480905
3	2	VY3040	LADDER SUPPORT TUBE	B820864
4	4	Z10018GA	1/2" x 1 1/2" BOLT ASSY.	CT10404
5	12	J44AA	3/8" J-BOLT ASSY.	B2942A
6	4	KH91	SADDLE CLAMP	B10214
7	2	H173	LADDER CLIP	B820993

ASSY. PIN VY3094A (10' SECTION) FOR 3" - 4" BRACE

ITEM	QTY.	PART NO.	DESCRIPTION	DWG. NO.
1	1	NL10	10'-0" LADDER SECTION	SK480905
2	2	KY95	LADDER SPICE PLATE	SK480905
3	2	VY3040	LADDER SUPPORT TUBE	B820864
4	4	Z10018GA	1/2" x 1 1/2" BOLT ASSY.	CT10404
5	4	J51A	3/8" J-BOLT ASSY.	B2947
6	4	KH91	SADDLE CLAMP	B10214
7	2	J44AA	3/8" J-BOLT ASSY.	B2942A
8	2	H174	LADDER CLIP	B820993

ASSY. PIN VY3095A (20' SECTION) FOR 3" - 4" BRACE

ITEM	QTY.	PART NO.	DESCRIPTION	DWG. NO.
1	1	NL20	20'-0" LADDER SECTION	SK480905
2	2	KY95	LADDER SPICE PLATE	SK480905
3	2	VY3040	LADDER SUPPORT TUBE	B820864
4	4	Z10018GA	1/2" x 1 1/2" BOLT ASSY.	CT10404
5	4	J51A	3/8" J-BOLT ASSY.	B2947
6	4	KH91	SADDLE CLAMP	B10214
7	2	J44AA	3/8" J-BOLT ASSY.	B2942A
8	2	H174	LADDER CLIP	B820993

RI ADDED ROHN-LOC NOTE
 No. 1 Revision: Description
 Date: 1-30-85
 By: [Signature]

UNR-Rohn
 Division of UNR, Inc.


LADDER, ASSY INSIDE COR. (7NST-16N)

Scale: NONE
 Drawn by: AWG
 Date: 12/29/82
 Checked by: [Signature]
 Date: 1/14/83
 Approved by Engineering: [Signature]
 Date: 1-19-83
 Approved by Production: [Signature]
 Date: [Blank]

Unless otherwise specified, dimensions are given in inches.
 Fractions: _____
 Decimals: _____
 Angles: _____
 Material: _____
 Finish: _____
 Weight: _____


This drawing is the property of UNR-Rohn, Inc. It is to be reproduced, copied or filed in whole or in part without our written consent.
 File Number: _____

Approved by Sales: [Signature] Date: 1-19-83
 Drawing Number: C821692 RI

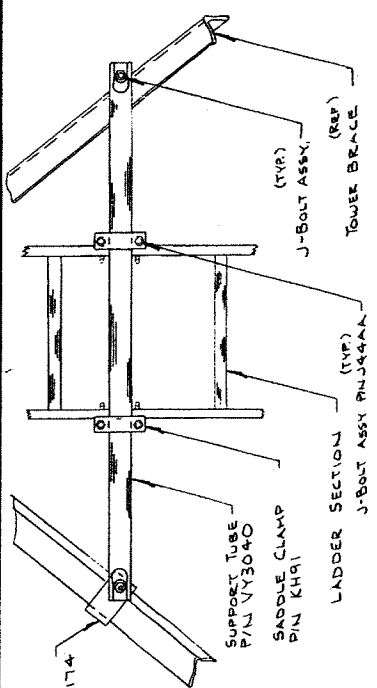


NOTE: IT IS RECOMMENDED A ROHN-LOC SAFETY DEVICE BE PROVIDED WITH LADDER INSTALLATIONS FOR ADDED CLIMBER SAFETY.

SECTION B-B

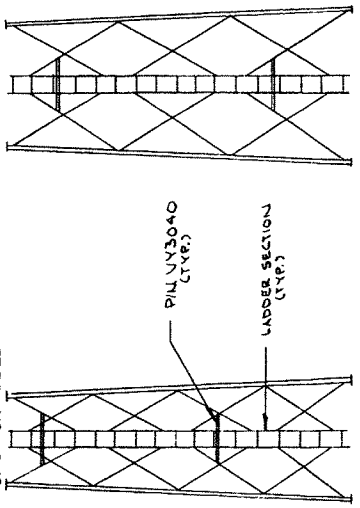

NOTE: SEE CHART BELOW FOR LOCATION OF PIN VY3040 ON INDIVIDUAL TOWER SECTIONS.

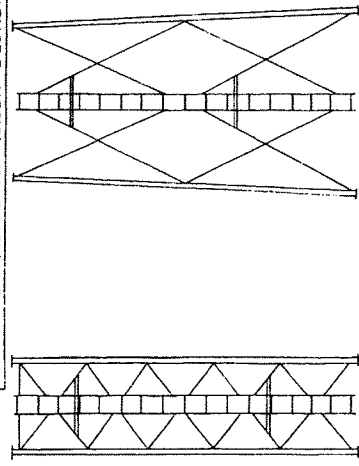

LADDER CONNECTION LOCATION CHART

20' SECTIONS	10' SECTIONS
SECT. ELEVATION 1	SECT. ELEVATION 1
1NST 5'-0" 16'-0"	TJST 1'-6" 9'-0"
8N BAY 1'-0" 18'-0"	8N BAY 2'-4" 8'-0"
9N BAY 1'-0" 17'-6"	9N BAY 1'-0" 7'-6"
10N 5'-0" 17'-6"	10N 1'-0" 7'-6"
11N 5'-0" 17'-6"	11N 1'-0" 7'-6"
12N 7'-0" 17'-0"	12N 7'-0" 17'-0"
13N 7'-0" 17'-0"	13N 7'-0" 17'-0"
14N 7'-0" 17'-0"	14N 7'-0" 17'-0"
15N 7'-0" 17'-0"	15N 7'-0" 17'-0"
16N 7'-0" 17'-0"	16N 7'-0" 17'-0"

TYP. TOWER SECTIONS
 -- ELEVATION --

NOTE: SECTION 'A-A' VIEWS ARE INCOMPLETE FOR CLARITY OF INSTALLATION