

Planning Commission Land Use Permit

Permit Number: LUP422-2016

Applicant

Name: Bingham Family Trust
Address: 140 11th Street

Phone:

Owner

Name: Bingham Family Trust
Address: 140 11th Street

Phone:

Parcel

Parcel Number: 231300004

Zoning: DRR-1

Total Parcel Area: 0.52 Acres

(*If Zoned S-1, See Specific Height Requirements)

Address: 8443 East Spring Park
Eden, UT 84310

****See Diagram on Back Side for Setbacks**

Section: 8

Township: 7N

Range: 2E

Subdivision: Summit Eden Phase 1C

Lot(s): 77

Proposed Structure: Residential

Structure Area Used: 5960

Is Structure > 1,000 Sq. Ft.?

*If True, Need Certif. Statement

of Dwelling Units: 1

of Accessory Bldgs: 0

Off-Street Parking Req'd: 2



Permit Checklist:

Public by/Right of Use Road?

> 200 ft. from Paved Road? No

< 4218 ft. above Sea Level? No

Wetlands/Flood Zone? No

Culvert Required? No

If Yes, Culvert Size:

***Any Work in the Right of Way requires an Excavation Permit**


Additional Frontage Req'd.? No OR Special Exception? False Case #

Meet Zone Area & Frontage? False Hillside Review Req'd.? NA Case #


Culinary Water District: Powder Mountain Waste Water System: Powder Mountain

Comments: The structure must be located within the approved building envelope with the allowable elements to be located outside of the building envelope per easment modification recorded August 5, 2015 as entry# 2749276. The site improvements must adhere to all recommendations in the geotechnical investigation report prepared by IGES dated August 7, 2014 and identified as Project No. 01628-006 as attached. Prior to receiving the final occupancy, a replacement slope easement is required to be submitted for the 40' slope easement as shown on the road dedication plat for Spring Park.


Structure Setback Graphic: New Dwelling, Additions

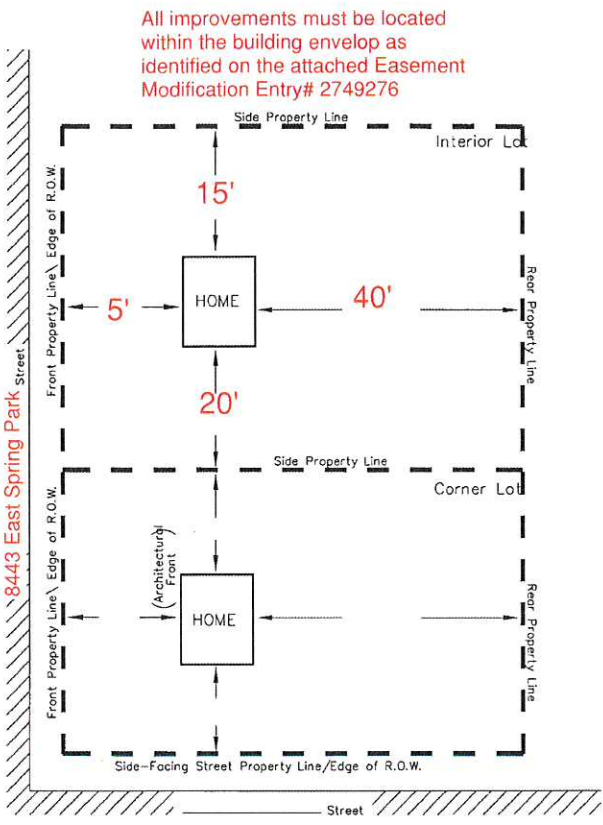

MINIMUM YARD SETBACKS
New Dwelling, Addition, Etc.

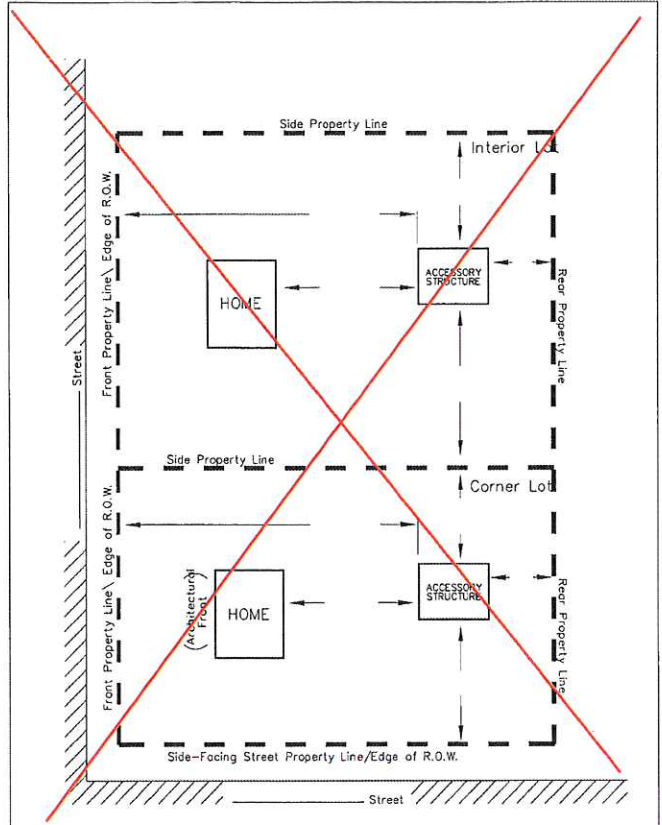

MINIMUM YARD SETBACKS
Storage Shed, Detached Garage, Etc.

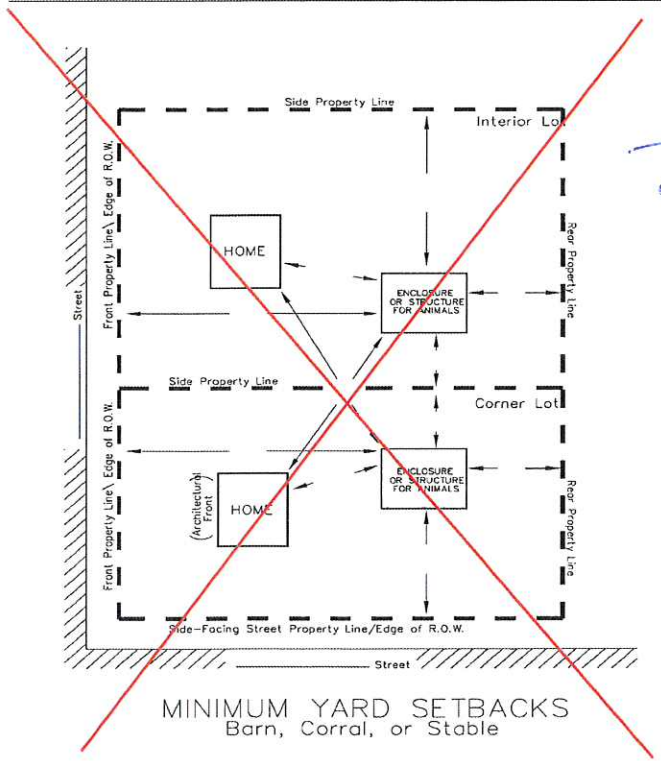

MINIMUM YARD SETBACKS
Barn, Corral, or Stable

NOTICE FOR APPLICANT (Please Read Before Signing)

Proposals for the installation of an individual water supply and for a sanitary waste disposal system (septic tank) for any structure designed for human occupation must be approved by the Weber County Health Department prior to installation.

Tracy Kiper 6/13/10

 Planning Dept. Signature of Approval Date

This permit becomes null and void if use or construction authorized has not commenced within 180 days or if there is a zone change affecting this property. I hereby certify that I have read and examined this application and know the same to be true and correct. All provisions of laws and ordinances governing this land use will be complied with whether specified herein or not. I make this statement under penalty of perjury. I hereby agree to make the requirements as specified on this permit issued to the owner of land as signed below.

 Contractor/Owner Signature of Approval Date



W2749276

WHEN RECORDED, MAIL TO:

Paul Strange
Summit Powder Mountain
3923 N. Wolf Creek Drive
Eden, Utah 84310
Ph. 801-987-0570

EN 2749276 PG 1 OF 5
LEANN H KILTS, WEBER COUNTY RECORDER
05-AUG-15 813 AM FEE \$20.00 DEP JKC
REC FOR: SUMMIT POWDER MOUNTAIN

NOTICE OF EASEMENT MODIFICATION

(Tax Parcel # 23-130-0044)

This NOTICE OF EASEMENT MODIFICATION is made this 20 day of July 2015, by SMHG Phase I LLC, a Delaware limited liability company and its successors and/or assigns (“Declarant”).

Notwithstanding Plat Notes 12 and 13 of the Summit Eden Phase 1C Subdivision recorded on January 27, 2014 as entry number 2672945 in the official records of Weber County, the Declarant hereby modifies its rights related to the “Trail Easement” and “Ski Easement” (both as defined in the above referenced plat).

This modification hereby excludes those certain portions of land described in attached Exhibit “A” (the “Exception Property”) from the said “Trail Easement” and “Ski Easement.” The Exception Property is also depicted visually in attached Exhibit “B.”

The Ski Easement and Trail Easement shall otherwise continue in force.

[Signatures on following page.]

IN WITNESS WHEREOF, Grantor has executed this Notice of Easement Modification as of the date first indicated above.

GRANTORS:

SMHG Phase I LLC, a Delaware limited liability company

By: SMHG Investments LLC, a Delaware limited liability company

Its: Sole Member



By: _____

Name: Paul Strange

Its: Authorized Signatory

STATE OF Utah)
:SS.
COUNTY OF Weber)

The foregoing instrument was acknowledged before me this 20 day of July, 2015, by Paul Strange, the authorized signatory for SMHG Investments LLC, the Sole Member of SMHG Phase I LLC.

KOAR

NOTARY PUBLIC
Residing at: Weber County

My Commission Expires:
4/25/18



EXHIBIT "A"**Exception Property**Exception Area 1 (patio)

Beginning at a point that is North 83.19 feet and West 47.90 feet from the southernmost lot corner of Lot 77 of Summit Eden Phase 1C Subdivision as recorded on January 27, 2014 as entry number 2672945 in the official records of Weber County, and running thence South $35^{\circ}26'25''$ West 5.98 feet; thence North $54^{\circ}33'35''$ West 45.01 feet; thence North $35^{\circ}26'25''$ East 30.17 feet; thence South $54^{\circ}33'35''$ East 18.50 feet; thence South $35^{\circ}26'25''$ West 24.19 feet; thence South $54^{\circ}33'35''$ East 26.51 feet to the point of beginning.

Contains 717 square feet.

Exception Area 2 (front entrance features)

Beginning at a point that is North 84.37 feet and East 25.74 feet from the southernmost lot corner of Lot 77 of Summit Eden Phase 1C Subdivision as recorded on January 27, 2014 as entry number 2672945 in the official records of Weber County, and running thence North $26^{\circ}45'20''$ East 18.01 feet to a point on a 52.50-foot radius curve (bearing to center North $13^{\circ}55'08''$ East); thence northwesterly along said curve to the right through a central angle of $65^{\circ}16'39''$ (chord bearing/distance is North $43^{\circ}26'33''$ West 56.63 feet) for a distance of 59.81 feet; thence North $60^{\circ}17'06''$ East 5.32 feet to a point on a 47.50-foot radius curve of Spring Park, a public road dedicated on January 27, 2014 as entry number 21072934 in the official records of Weber County (bearing to center North $81^{\circ}16'33''$ East); thence southeasterly along said curve to the left through a central angle of $76^{\circ}01'09''$ (chord bearing/distance is South $46^{\circ}44'02''$ East 58.50 feet) for a distance of 63.02 feet; thence South $26^{\circ}45'20''$ West 25.00 feet; thence North $63^{\circ}14'40''$ West 5.74 feet to the point of beginning.


Contains 430 square feet.

EXHIBIT B

Depiction of Exception Property

(attached)

EXHIBIT B

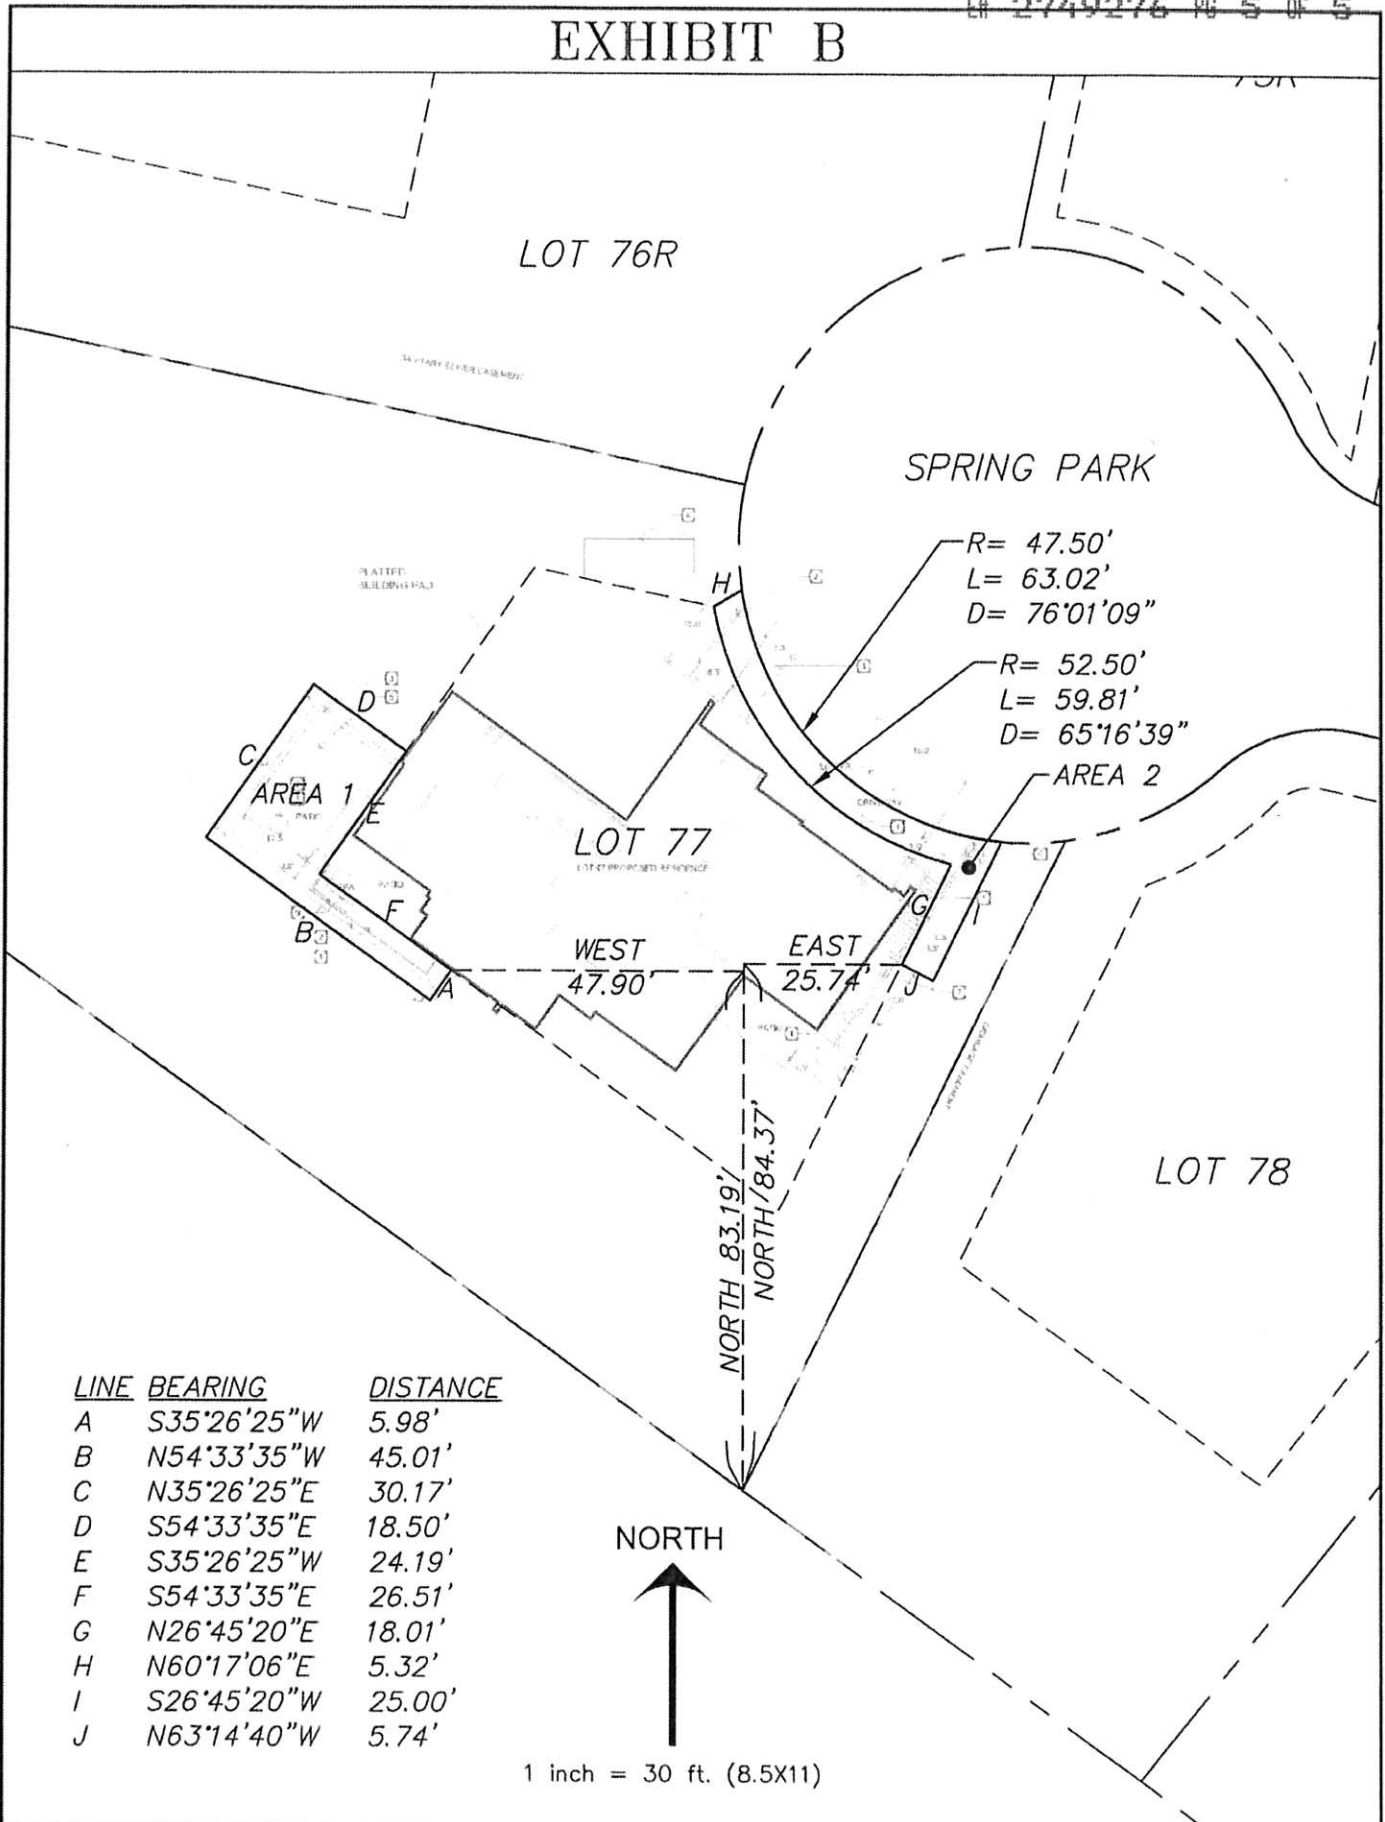



IGES[®]

Intermountain GeoEnvironmental Services, Inc.
12429 South 300 East Suite 100, Draper, Utah 84020 ~ T: (801) 748-4044 ~ F: (801) 748-4045

August 7, 2014

Mr. Grant H. Blakeslee
Summit, LLC
3632 North Wolf Creek Drive
Eden, Utah 84310

IGES Project No. 01628-006

**RE: Geotechnical Investigation Report
Lot 77 of Powder Mountain Resort
8443 East Spring Park
Weber County, Utah**

Mr. Blakeslee,

As requested, IGES has conducted a geotechnical investigation for the proposed residence to be constructed on Lot 77 of the Powder Mountain Resort located at 8443 East Spring Park in Weber County, Utah. The approximate location of the property is illustrated on the *Site Vicinity Map* (Figure A-1 in Appendix A). The purposes of our investigation was to assess the nature and engineering properties of the subsurface soils at the proposed home site and to provide recommendations for the design and construction of foundations, grading, and drainage. The scope of work completed for this study included subsurface exploration, laboratory testing, engineering analyses and preparation of this letter.

Project Understanding

Our understanding of the project is based primarily on our previous involvement with the Powder Mountain resort project, which included two geotechnical investigations for the greater 200-acre Powder Mountain Resort expansion project (IGES, 2012a and 2012b).

The Powder Mountain Resort expansion project is located southeast of SR-158 (Powder Mountain Road), south of previously developed portions of Powder Mountain Resort, in unincorporated Weber County, Utah. The project is accessed by Powder Ridge Road.

Lot 77 is a ½-acre single-family residential lot with a buildable envelope of approximately 0.13 acres. A single-family home will be constructed at the site, presumably a high-end vacation home. Construction plans were not available for our review; however, we assume the new home will be a one- or two-story wood-framed structure, with a basement, founded on conventional spread footings. The development is expected to include improvements common for residential developments such as underground utilities, curb and gutter, flatwork, landscaping, and possibly appurtenant structures.

METHOD OF STUDY

Literature Review

IGES completed a geotechnical investigation for the Powder Mountain Resort expansion in 2012 (2012a, 2012b). Our previous work included twenty-two test pits and one soil boring excavated at various locations across the 200-acre development; as a part of this current study, the logs from relevant nearby test pits and other data from our reports were reviewed. In addition, Western Geologic (2012) completed a geologic hazard study for the greater 200-acre Powder Mountain expansion project – this report was reviewed to assess the potential impact of geologic hazards on the subject lot.

Field Investigation

Subsurface soils were investigated by excavating one test pit approximately 11 feet below the existing site grade. The approximate location of the test pit is illustrated on the *Geotechnical Map* (Figure A-2 in Appendix A). The soil types and conditions were visually logged at the time of the excavation in general accordance with the Unified Soil Classification System (USCS). Subsurface soil classifications and descriptions are included on the test pit log included as Figure A-3 in Appendix A. A key to USCS symbols and terminology is included as Figure A-4.

Laboratory Testing

Samples retrieved during the subsurface investigation were transported to the laboratory for evaluation of engineering properties. Specific laboratory tests include:

- Atterberg Limits
- Soluble Sulfate, Soluble Chloride, pH and Resistivity

Results of the laboratory testing are discussed in this report and presented in Appendix B. Some test results, including moisture content and Atterberg Limits, have been incorporated into the test pit log (Figure A-3).

In addition to laboratory testing on samples obtained from this lot, engineering analysis was also based on our previously completed laboratory work on soil samples obtained near the site (IGES, 2012a & 2012b).

Engineering Analysis

Engineering analyses were performed using soil data obtained from laboratory testing and empirical correlations based on material density, depositional characteristics and classification. Appropriate factors of safety were applied to the results consistent with industry standards and the accepted standard of care. An allowable bearing pressure value was proportioned based on estimated shear strength of bearing soils.

FINDINGS

Surface Conditions

At the time of the excavation, the lot was in a relatively natural state and was covered with a variety of vegetation including several mature trees, weeds and native grasses. The site drains gently to the south.

Earth Materials

The soil at the surface of the site consists of approximately 6 inches of poorly-developed topsoil consisting of dark brown clayey gravel. The topsoil encountered was characterized by an abundance of organic matter (roots, etc.) and cobbles. The topsoil was underlain by dense clayey gravel; this soil unit was heavily rooted in the upper 3.5 feet and is estimated to consist of approximately 60% to 70% cobbles up to 8 inches in diameter. Boulders up to 24 inches in diameter were also encountered. These rocky soils are generally clast-supported; the matrix generally consists of reddish-brown clay. This rocky layer extended to the maximum depth of exploration of approximately 11 feet below existing grade.

Detailed descriptions of earth materials encountered are presented on the test pit log, Figure A-3, in Appendix A.

Groundwater

Groundwater was not encountered in the test pit excavation. Based on our observations, groundwater is not anticipated to adversely impact the proposed construction. However, groundwater levels could rise at any time based on several factors including recent precipitation, on- or off-site runoff, irrigation, and time of year (e.g., spring run-off). Should the groundwater become a concern during the proposed construction, IGES should be contacted so that dewatering recommendations may be provided.

Geology and Geologic Hazards

Geology and geologic hazards have been previously addressed by Western Geologic in a separate submittal (Western Geologic, 2012). This work has also been referenced in our previous geotechnical reports for the project (IGES, 2012a and 2012b). The report by Western Geologic indicates that the lot is located outside of known geologically unstable areas.

During our subsurface investigation, potentially adverse geologic structures (e.g., evidence of faulting or landslides) were not evident to the maximum depth of exploration (11 feet). Geomorphic expressions of shallow, surficial landslides were not observed on, or near the lot. Based on currently available data and our observations, the potential for geologic hazards such as landslides, liquefaction, or surface fault rupture impacting the site is considered low.

Seismicity

Following the criteria outlined in the 2012 International Building Code (IBC, 2012), spectral response at the site was evaluated for the *Maximum Considered Earthquake*

(MCE) which equates to a probabilistic seismic event having a two percent probability of exceedance in 50 years (2PE50). Spectral accelerations were determined based on the location of the site using the *U.S. Seismic "DesignMaps" Web Application* (USGS, 2012); this software incorporates seismic hazard maps depicting probabilistic ground motions and spectral response data developed for the United States by the U. S. Geological Survey as part of NEHRP/NSHMP (Frankel et al., 1996). These maps have been incorporated into both *NEHRP Recommended Provisions for Seismic Regulations for New Buildings and Other Structures* (FEMA, 1997) and the *International Building Code* (IBC) (International Code Council, 2012).

To account for site effects, site coefficients that vary with the magnitude of spectral acceleration and *Site Class* are used. Site Class is a parameter that accounts for site amplification effects of soft soils and is based on the average shear wave velocity of the upper 100 feet; based on our field exploration and our understanding of the geology in this area, the subject site is appropriately classified as Site Class C (*Very Dense Soil and Soft Rock*). Based on IBC criteria, the short-period (F_a) coefficient is 1.075 and long-period (F_v) site coefficient is 1.530. Based on the design spectral response accelerations for a *Building Risk Category* of I, II or III, the site's *Seismic Design Category* is D. The short- and long-period *Design Spectral Response Accelerations* are presented in Table 1.0; a summary of the *Design Maps* analysis is presented in Appendix C. The *peak ground acceleration* (PGA) may be taken as $0.4 \cdot S_{MS}$.

CONCLUSIONS AND RECOMMENDATIONS

Based on the results of the field observations, laboratory testing, and previously completed geotechnical investigation (IGES, 2012a), the subsurface conditions are considered suitable for the proposed construction provided that the recommendations presented in this report are incorporated into the design and construction of the project.

General Site Preparation and Grading

Prior to the placement of foundations, general site grading is recommended to provide proper support for exterior concrete flatwork, concrete slabs-on-grade, and pavement sections. Site grading is also recommended to provide proper drainage and moisture control on the subject property and to aid in preventing differential movement in foundation soils as a result of variations in moisture conditions.

Below proposed structures, fills, and man-made improvements, all vegetation, topsoil, debris and undocumented fill soils (if any) should be removed. Any existing utilities should be re-routed or protected in place. The exposed native soils should then be proof-rolled with heavy rubber-tired equipment such as a scraper or loader. Any soft/loose areas identified during proof-rolling should be removed and replaced with structural fill. All excavation bottoms should be observed by an IGES representative during proof rolling or otherwise prior to placement of engineered fill to evaluate whether soft, loose, or otherwise deleterious earth materials have been removed and that recommendations presented in this report have been complied with.

Excavations

Soft, loose, or otherwise unsuitable soils beneath structural elements, hardscape or pavements may need to be over-excavated and replaced with structural fill. If over-excavation is required, the excavations should extend one foot laterally for every foot of depth of over-excavation. Excavations should extend laterally at least two feet beyond flatwork, pavements, and slabs-on-grade. Structural fill should consist of granular materials and should be placed and compacted in accordance with the recommendations presented in this report.

Prior to placing engineered fill, all excavation bottoms should be scarified to at least 6 inches, moisture conditioned as necessary at or slightly above optimum moisture content (OMC), and compacted to at least 90 percent of the maximum dry density (MDD) as determined by ASTM D-1557 (Modified Proctor). Scarification is not required where bedrock is exposed.

Excavation Stability

The contractor is responsible for site safety, including all temporary trenches excavated at the site and the design of any required temporary shoring. The contractor is responsible for providing the "competent person" required by Occupational Safety and Health (OSHA) standards to evaluate soil conditions. For planning purposes, Soil Type C is expected to predominate at the site (sands and gravels). Close coordination between the competent person and IGES should be maintained to facilitate construction while providing safe excavations.

Based on OSHA guidelines for excavation safety, trenches with vertical walls up to 5 feet in depth may be occupied. Where very moist soil conditions or groundwater is encountered, or when the trench is deeper than 5 feet, we recommend a trench-shield or shoring be used as a protective system to workers in the trench. As an alternative to shoring or shielding, trench walls may be laid back at one and one half horizontal to one vertical (1½H:1V) (34 degrees) in accordance with OSHA Type C soils. Trench walls may need to be laid back at a steeper grade pending evaluation of soil conditions by the geotechnical engineer. Soil conditions should be evaluated in the field on a case-by-case basis. Large rocks exposed on excavation walls should be removed (scaled) to minimize rock fall hazards.

Structural Fill and Compaction

All fill placed for the support of structures, flatwork or pavements should consist of structural fill. Structural fill should consist of granular native soils, which may be defined as soils with less than 25% fines, 10-60% sand, and contain no rock larger than 4 inches in nominal size (6 inches in greatest dimension). Structural fill should also be free of vegetation and debris. Soils not meeting these criteria may be suitable for use as structural fill; however, such soils should be evaluated on a case by case basis and should be approved by IGES prior to use.

All structural fill should be placed in maximum 4-inch loose lifts if compacted by small hand-operated compaction equipment, maximum 6-inch loose lifts if compacted by light-

duty rollers, and maximum 8-inch loose lifts if compacted by heavy duty compaction equipment that is capable of efficiently compacting the entire thickness of the lift. Additional lift thickness may be allowed by IGES provided the Contractor can demonstrate sufficient compaction can be achieved with a given lift thickness with the equipment in use. We recommend that all structural fill be compacted on a horizontal plane, unless otherwise approved by IGES. Structural fill underlying all shallow footings and pavements should be compacted to at least 95 percent of the MDD as determined by ASTM D-1557. The moisture content should be at, or slightly above, the OMC for all structural fill. Any imported fill materials should be approved prior to importing. Also, prior to placing any fill, the excavations should be observed by IGES to confirm that unsuitable materials have been removed.

Specifications from governing authorities such as Weber County and/or special service districts having their own precedence for backfill and compaction should be followed where more stringent.

Utility Trench Backfill

Utility trenches should be backfilled with structural fill in accordance with the previous section. Utility trenches can be backfilled with the onsite soils free of debris, organic and oversized material. Prior to backfilling the trench, pipes should be bedded in and shaded with a uniform granular material that has a Sand Equivalent (SE) of 30 or greater. Pipe bedding may be water-densified in-place (jetting). Alternatively, pipe bedding and shading may consist of clean ¾-inch gravel, which generally does not require densification. Native earth materials can be used as backfill over the pipe bedding zone. All utility trenches backfilled below pavement sections, curb and gutter, hardscape, should be backfilled with structural fill compacted to at least 95 percent of the MDD as determined by ASTM D-1557. All other trenches should be backfilled and compacted to approximately 90 percent of the MDD (ASTM D-1557). However, in all cases the pipe bedding and shading should meet the design criteria of the pipe manufacturer. Specifications from governing authorities having their own precedence for backfill and compaction should be followed where they are more stringent.

Oversize Material

Based on our observations at the site there is a significant potential for the presence of oversize materials (larger than 6 inches in greatest dimension). Large rocks, particularly boulders (>12 inches), may require special handling, such as segregation from structural fill, and disposal. Particularly large boulders may require special equipment for removal during excavation of the basement.

Foundations

Based on our field observations and considering the presence of relatively competent native earth materials, we recommend that the footings for proposed home be founded either *entirely* on competent native soils or *entirely* on structural fill. Native/fill transition zones are not allowed. If soft, loose, or otherwise deleterious earth materials are exposed in the footing excavations, then the footings should be deepened such that all footings bear on relatively uniform, competent native earth materials. Alternatively, the foundation

excavation may be over-excavated a minimum of 2 feet below the bottom of proposed footings and replaced with structural fill, such that the footings bear entirely on a uniform fill blanket. We recommend that IGES inspect the bottom of the foundation excavation prior to the placement of steel or concrete to identify the competent native earth materials as well as any unsuitable soils or transition zones. Additional over-excavation may be required based on the actual subsurface conditions observed.

Shallow spread or continuous wall footings constructed entirely on competent, uniform native earth materials or on a minimum of 2 feet of *structural fill* may be proportioned utilizing a maximum net allowable bearing pressure of **2,300 pounds per square foot (psf)** for dead load plus live load conditions. The net allowable bearing value presented above is for dead load plus live load conditions. The minimum recommended footing width is 20 inches for continuous wall footings and 30 inches for isolated spread footings.

All conventional foundations exposed to the full effects of frost should be established at a minimum depth of 42 inches below the lowest adjacent final grade. Interior footings, not subjected to the full effects of frost (i.e., *a continuously heated structure*), may be established at higher elevations, however, a minimum depth of embedment of 12 inches is recommended for confinement purposes.

Foundation drains should be installed around below-ground foundations (e.g., basement walls) to minimize the potential for flooding from shallow groundwater, which may be present at various times during the year, particularly spring run-off.

Settlement

Static settlement of properly designed and constructed conventional foundations, founded as described above, are anticipated to be on the order of 1 inch or less. Differential settlement is expected to be half of total settlement over a distance of 30 feet.

Competent native earth materials and/or properly compacted structural fill is expected to exhibit negligible seismically-induced settlement during a MCE seismic event.

Earth Pressure and Lateral Resistance

Lateral forces imposed upon conventional foundations due to wind or seismic forces may be resisted by the development of passive earth pressures and friction between the base of the footing and the supporting soils. In determining the frictional resistance against concrete, a coefficient of friction of 0.45 for sandy native soils or structural fill should be used.

Ultimate lateral earth pressures from *granular* backfill acting against retaining walls, temporary shoring, or buried structures may be computed from the lateral pressure coefficients or equivalent fluid densities presented in Table 2.0. These coefficients and densities assume no buildup of hydrostatic pressures. The force of water should be added to the presented values if hydrostatic pressures are anticipated.

Table 2.0
Lateral Earth Pressure Coefficients

Condition	Level Backfill		2H:1V Backfill	
	Lateral Pressure Coefficient	Equivalent Fluid Density (pcf)	Lateral Pressure Coefficient	Equivalent Fluid Density (pcf)
Active (Ka)	0.33	35	0.53	56
At-rest (Ko)	0.50	55	0.80	85
Passive (Kp)	3.0	320	—	—

Clayey soils drain poorly and may swell upon wetting, thereby greatly increasing lateral pressures acting on earth retaining structures; therefore, clayey soils should not be used as retaining wall backfill. Backfill should consist of native granular soil with an Expansion Index (EI) less than 20.

Walls and structures allowed to rotate slightly should use the active condition. If the element is to be constrained against rotation (i.e., a basement or buried tank wall), the at-rest condition should be used. These values should be used with an appropriate factor of safety against overturning and sliding. A value of 1.5 is typically used. Additionally, if passive resistance is calculated in conjunction with frictional resistance, the passive resistance should be reduced by ½.

Concrete Slab-on-Grade Construction

To minimize settlement and cracking of slabs, and to aid in drainage beneath the concrete floor slabs, all concrete slabs should be founded on a minimum 4-inch layer of compacted gravel overlying properly prepared subgrade. The gravel should consist of free-draining gravel or road base with a ¾-inch maximum particle size and no more than 5 percent passing the No. 200 mesh sieve. The layer should be compacted to at least 95 percent of the MDD as determined by ASTM D-1557.

All concrete slabs should be designed to minimize cracking as a result of shrinkage. Consideration should be given to reinforcing the slab with a welded wire fabric, re-bar, or fibermesh. Slab reinforcement should be designed by the structural engineer; however, as a minimum, slab reinforcement should consist of 4'x4' W4.0xW4.0 welded wire mesh within the middle third of the slab. We recommend that concrete be tested to assess that the slump and/or air content is in compliance with the plans and specifications. We recommend that concrete be placed in general accordance with the requirements of the American Concrete Institute (ACI). A Modulus of Subgrade Reaction of **250 psi/inch** may be used for design.

A moisture barrier (vapor retarder) consisting of 10-mil thick Visqueen (or equivalent) plastic sheeting should be placed below slabs-on-grade where moisture-sensitive floor coverings or equipment is planned. Prior to placing this moisture barrier, any objects that could puncture it, such as protruding gravel or rocks, should be removed from the building pad. Alternatively, the subgrade may be covered with 2 inches of clean sand.

Moisture Protection

Moisture should not be allowed to infiltrate into the soils in the vicinity of the foundations. As such, design strategies to minimize ponding and infiltration near the home should be implemented. The new home may be subject to sheet flow during periods of heavy rain or snow melt; therefore, the Civil Engineer may also wish to consider construction of additional surface drainage to intercept surface runoff, or a curtain drain to intercept seasonal groundwater flow, if any.

We recommend that hand watering, desert landscaping or Xeriscape be considered within 5 feet of the foundations. We further recommend roof runoff devices be installed to direct all runoff a minimum of 10 feet away from structures. The home builder should be responsible for compacting the exterior backfill soils around the foundation. Additionally, the ground surface within 10 feet of the house should be constructed so as to slope a minimum of **five** percent away from the home. Pavement sections should be constructed to divert surface water off of the pavement into storm drains. Parking strips and roadway shoulder areas should be constructed to prevent infiltration of water into the areas surrounding pavement. Landscape plans must conform to Weber County development codes.

IGES recommends a perimeter foundation drain be constructed for the proposed residential structure in accordance with the International Residential Code (IRC).

Soil Corrosion Potential

Laboratory testing of a representative soil sample obtained from the test pit indicated that the soil sample tested had a sulfate content of 7 ppm. Accordingly, the soils are classified as having a 'low' potential for deterioration of concrete due to the presence of soluble sulfate. As such, conventional Type I/II Portland cement may be used for all concrete in contact with site soils.

To evaluate the corrosion potential of ferrous metal in contact with onsite native soil a sample was tested for soil resistivity, soluble chloride and pH. The test indicated that the onsite soil tested has a minimum soil resistivity of 6,673 OHM-cm, soluble chloride content of 3.3 ppm and a pH of 6.5. Based on this result, the onsite native soil is considered to be *moderately corrosive* to ferrous metal. Consideration should be given to retaining the services of a qualified corrosion engineer to provide an assessment of any metal that may be associated with construction of ancillary water lines and reinforcing steel, valves etc.

Construction Considerations

Although shallow bedrock was not identified during our subsurface investigation, it is known that shallow bedrock may occur locally within this area. Although not anticipated, if shallow bedrock is encountered, this material may require special equipment and/or blasting for removal during excavation of the basement.

Several large boulders (up to 24 inches) were observed within the test pit and on the surface; as such, excavation of the basement may generate an abundance of over-size material that may require special handling, processing, or disposal.

CLOSURE

The recommendations presented in this letter are based on limited field exploration, literature review, and a general understanding of the proposed construction. The subsurface data used in the preparation of this letter were obtained from the exploration(s) made for this investigation. It is possible that variations in the soil and groundwater conditions could exist beyond the point explored. The nature and extent of variations may not be evident until construction occurs. If any conditions are encountered at this site that are different from those described in this letter, IGES should be immediately notified so that any necessary revisions to recommendations contained in this letter may be made. In addition, if the scope of the proposed construction changes from that described in this letter, IGES should also be notified.

This report was prepared in accordance with the generally accepted standard of practice at the time the report was written. No warranty, expressed or implied, is made.

It is the Client's responsibility to see that all parties to the project including the Designer, Contractor, Subcontractors, etc. are made aware of this letter in its entirety. The use of information contained in this report for bidding purposes should be done at the Contractor's option and risk.

Additional Services

The recommendations presented in this report are based on the assumption that an adequate program of tests and observations will be made during the construction. IGES staff should be on site to verify compliance with these recommendations. These tests and observations should include, but not necessarily be limited to, the following:

- Observations and testing during site preparation, earthwork and structural fill placement.
- Consultation as may be required during construction.
- Quality control testing of cast-in-place concrete.
- Review of plans and specifications to assess compliance with our recommendations.

Lot 77 of Powder Mountain Resort
8443 East Spring Park, Weber County, Utah

We appreciate the opportunity to be of service on this project. Should you have any questions regarding the report or wish to discuss additional services, please contact the undersigned at (801) 748-4044.

**Respectfully submitted,
IGES, Inc.**



Shun Li, P.E.I.
Staff Engineer

Reviewed by:



David A. Glass, P.E.
Senior Geotechnical Engineer

Attachments:

References

Appendix A

- Figure A-1 – Site Vicinity Map
- Figure A-2 – Geotechnical Map
- Figure A-3 – Test Pit Log
- Figure A-4 – Key to Soil Symbols and Terminology

Appendix B – Laboratory Results

Appendix C – 2012 IBC MCE and Design Response Acceleration

References

- AMEC, 2001, Report Engineering Geologic Reconnaissance/Geotechnical Study Powder Mountain Resort.
- Federal Emergency Management Agency [FEMA], 1997, *NEHRP Recommended Provisions for Seismic Regulations for New Buildings and Other Structures*, FEMA 302, Washington, D.C.
- Frankel, A., Mueller, C., Barnard, T., Perkins, D., Leyendecker, E.V., Dickman, N., Hanson, S., and Hopper, M., 1996, *National Seismic-hazard Maps: Documentation*, U.S. Geological Survey Open-File Report 96-532, June.
- IGES, Inc., 2012a, Design Geotechnical Investigation, Powder Mountain Resort, Weber County, Utah, Project No. 01628-003, dated November 9, 2012.
- IGES, Inc., 2012b, Preliminary Geotechnical Investigation, Powder Mountain Resort, Weber County, Utah, Project No. 01628-001, dated July 26, 2012.
- International Building Code [IBC], 2012, International Code Council, Inc.
- PSI, 2012, Geophysical ReMi Investigation, Powder Mountain Resort, Phase 1A, Weber County, Utah, PSI Project No. 0710375, dated September 18, 2012.
- U.S. Geological Survey, 2012, U.S. *Seismic "Design Maps" Web Application*, site: <https://geohazards.usgs.gov/secure/designmaps/us/application.php>.
- Western Geologic, 2012, Report: Geologic Hazards Reconnaissance, Proposed Area 1 Mixed-Use Development, Powder Mountain Resort, Weber County, Utah, dated August 28, 2012.

PROJECT
SITE

APPENDIX A

1

APPENDIX A

1.1

1.2

1.3

1.4

1.5

1.6

1.7

1.8

1.9

1.10

1.11

1.12

1.13

1.14

1.15

1.16

1.17

1.18

1.19

1.20

1.21

1.22

1.23

1.24

1.25

1.26

1.27

1.28

1.29

1.30

1.31

1.32

1.33

1.34

1.35

1.36

1.37

1.38

1.39

1.40

1.41

1.42

1.43

1.44

1.45

1.46

1.47

1.48

1.49

1.50

1.51

1.52

1.53

1.54

1.55

1.56

1.57

1.58

1.59

1.60

1.61

1.62

1.63

1.64

1.65

1.66

1.67

1.68

1.69

1.70

1.71

1.72

1.73

1.74

1.75

1.76

1.77

1.78

1.79

1.80

1.81

1.82

1.83

1.84

1.85

1.86

1.87

1.88

1.89

1.90

1.91

1.92

1.93

1.94

1.95


1.96

1.97

1.98

1.99

2.00

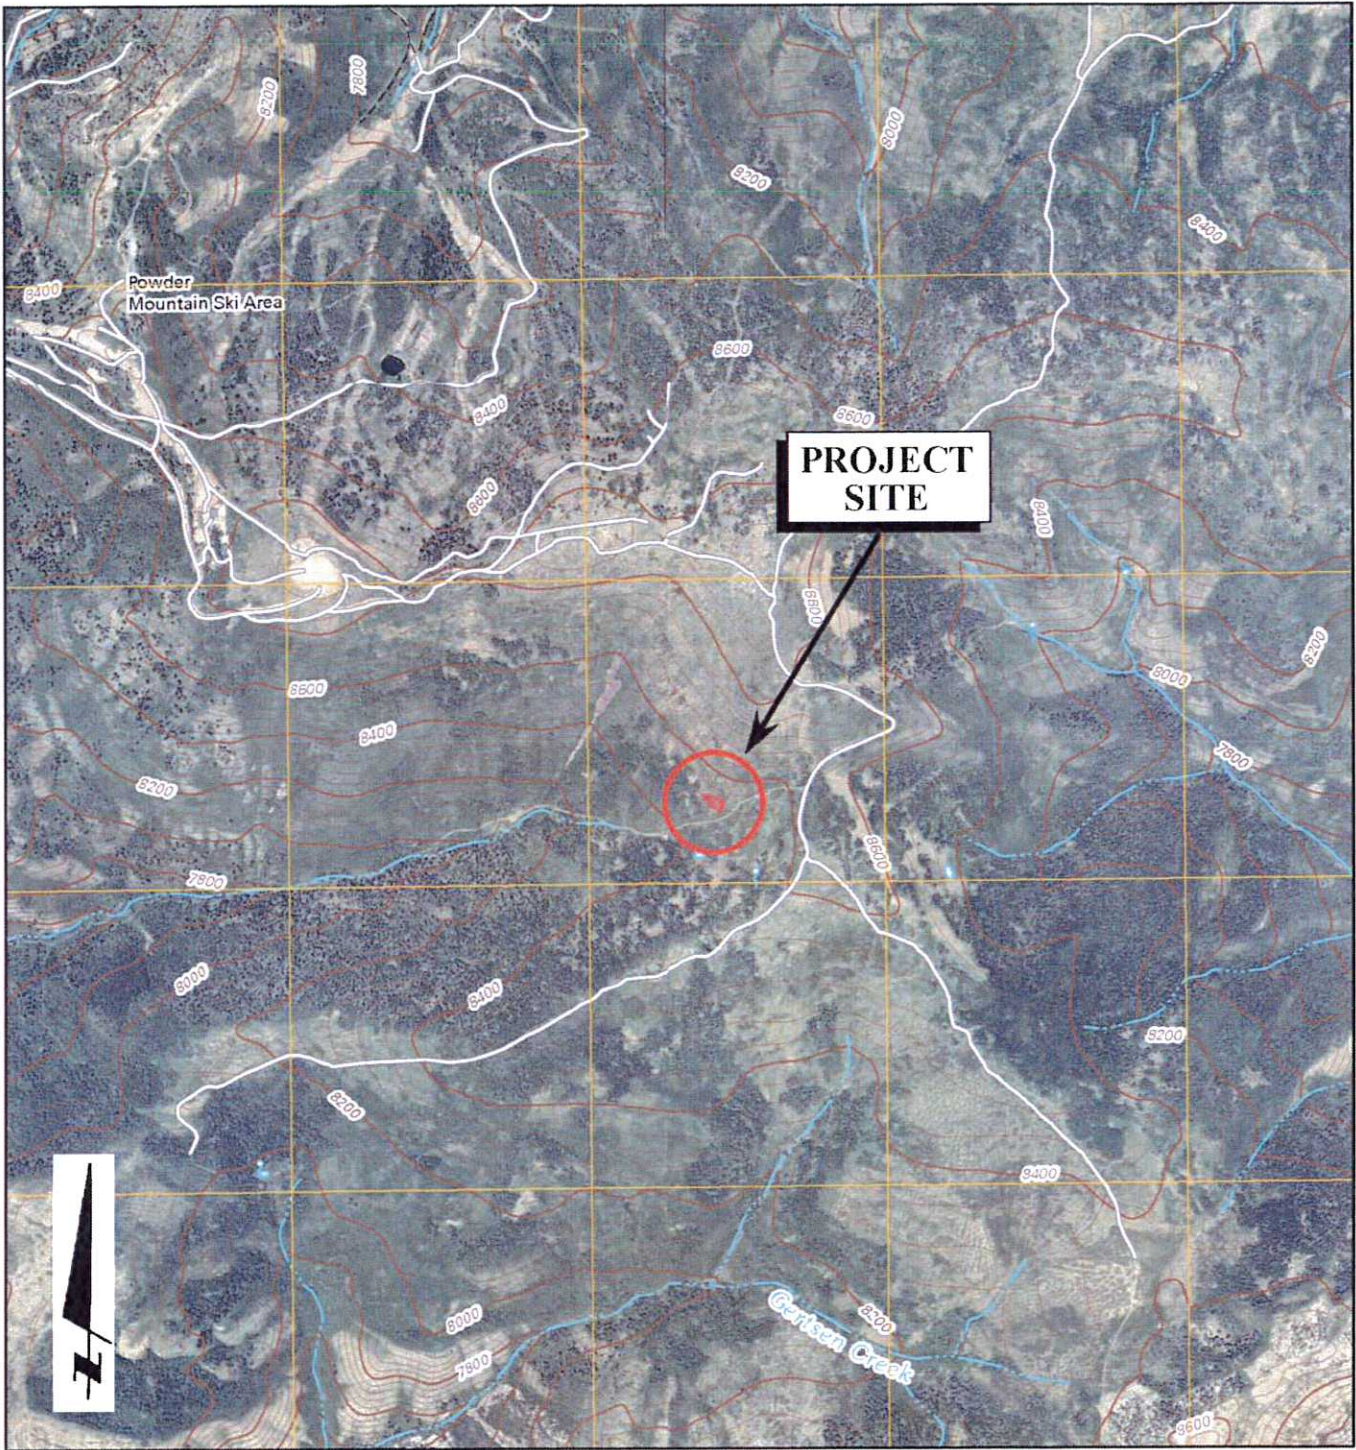

BASE MAP:
 USGS Huntsville, Browns Hole, James Peak and Sharp Mountain
 7.5-Minute Quadrangle Topographic Maps (2011)



MAP LOCATION

0' 1000' 2000'
 SCALE 1:24,000




Project No. 01628-006

Geotechnical Investigation
 Lot 77 of Powder Mountain Resort
 8443 East Spring Park
 Weber County, Utah

SITE VICINITY MAP

Figure
 A-1

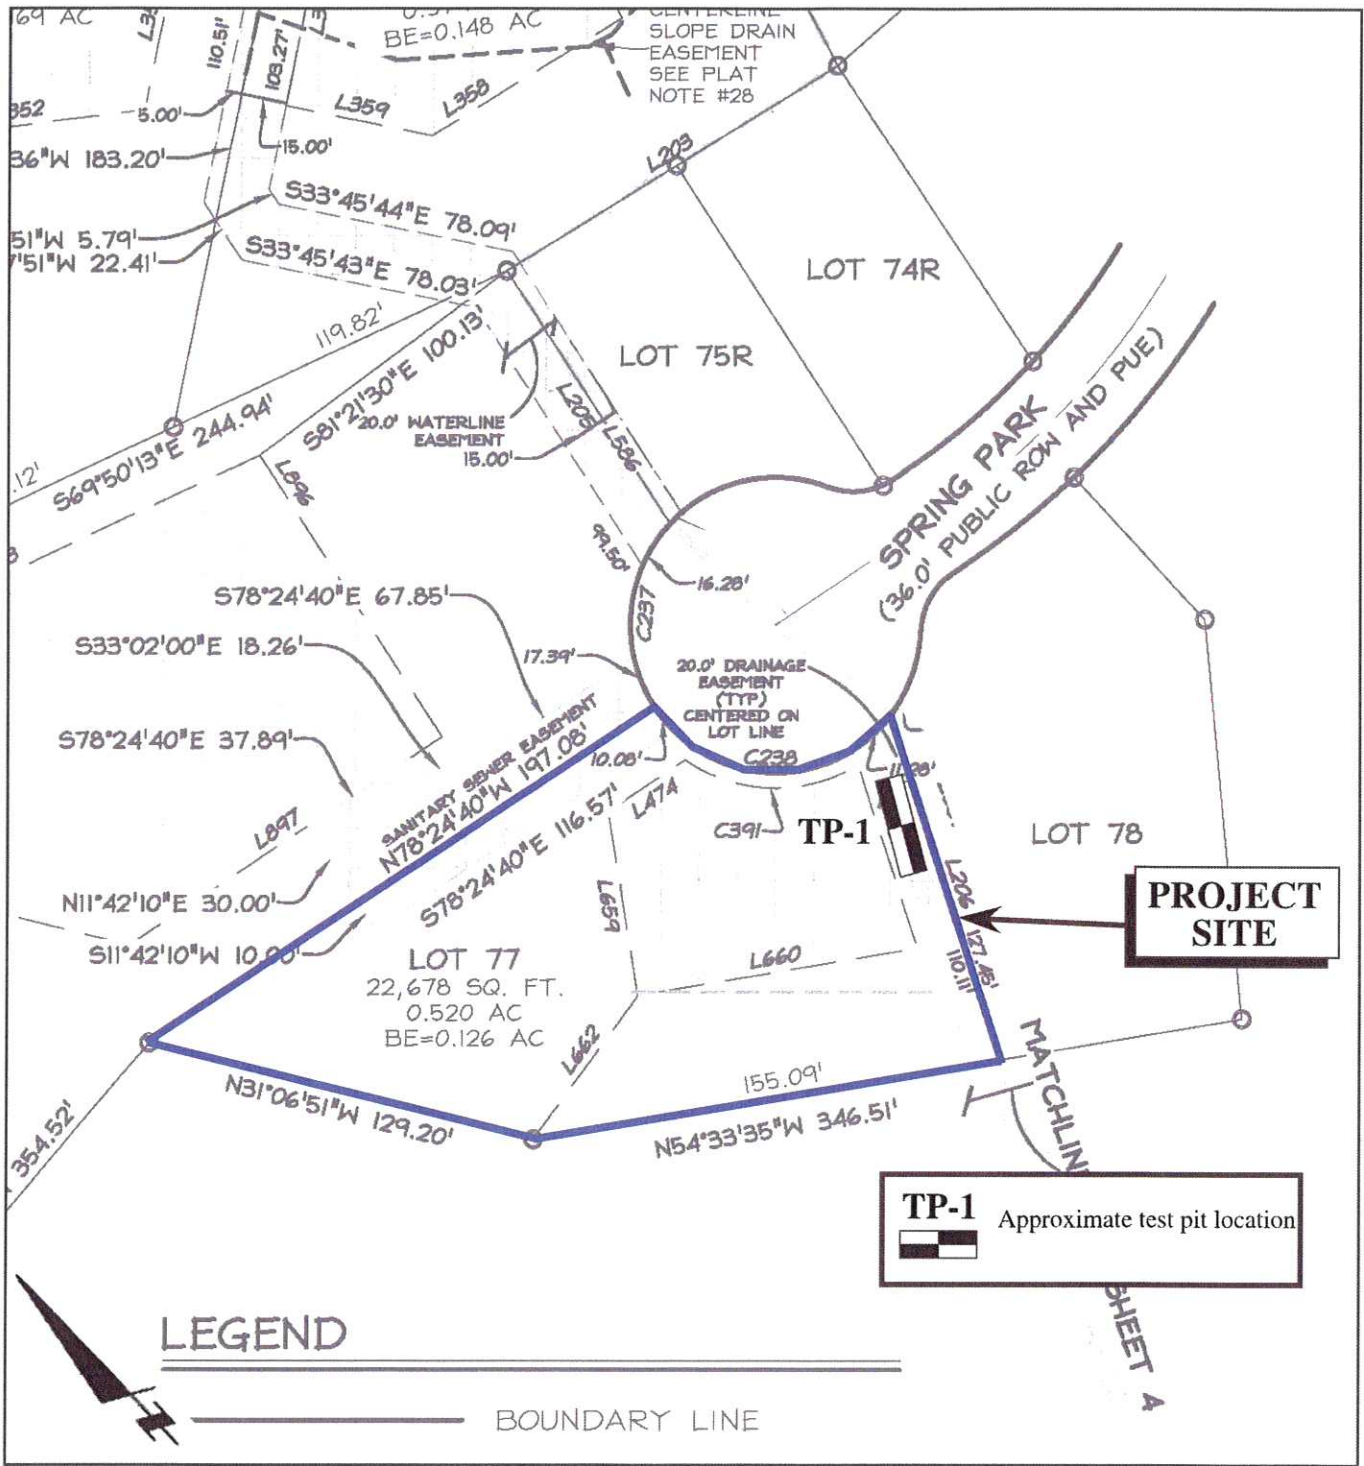

Base Map:
Summit Eden Phase 1C, Sheet 3
Prepared by NV5, Dated January 2014



IGES[®]

Project No. 01628-006

Geotechnical Investigation
Lot 77 of Powder Mountain Resort
8443 East Spring Park
Weber County, Utah

GEOTECHNICAL MAP

Figure
A-2

LOG OF TEST PITS (A) -4 LINE HEADER W/ ELEV.) 01628-006 LOT 77 GPJ IGES.GDT 8/6/14

DATE STARTED: 7/18/14 COMPLETED: 7/18/14 BACKFILLED: 7/18/14		Geotechnical Investigation Lot 77 of Powder Mountain Resort 8443 East Spring Park Weber County, Utah Project Number 01628-006				IGES Rep: SL Rig Type: trackhoe		TEST PIT NO: <h1 style="margin: 0;">TP-1</h1> Sheet 1 of 1							
										LOCATION LATITUDE 41.36257 LONGITUDE -111.74771 ELEVATION 8,555					
										DEPTH	ELEVATION	FEET	SAMPLES	WATER LEVEL	GRAPHICAL LOG
0	8550	5			[Hatched Pattern]	GC	Clayey GRAVEL - 70% cobbles - dense, moist, dark brown, heavy roots in upper 3.5 feet, cobbles up to 8 inches in diameter, sub-rounded reddish brown clayey matrix, clast-supported - %60 cobbles - reddish brown, cobbles up to 6 inches in diameter - cobbles and boulders up to 24 inches in diameter with a reddish brown lean clay matrix, clast-supported		10.7					Plastic Limit Moisture Content Liquid Limit -----●----- 10 20 30 40 50 60 70 80 90	
10	8545						No groundwater encountered Bottom of Test Pit @ 11 Feet								



Copyright (c) 2014, IGES, INC.

- SAMPLE TYPE**
- ▭ - GRAB SAMPLE
 - ⊠ - 3" O.D. THIN-WALLED HAND SAMPLER
- WATER LEVEL**
- ▼ - MEASURED
 - ▽ - ESTIMATED

NOTES:

FIGURE
A - 3

UNIFIED SOIL CLASSIFICATION SYSTEM

MAJOR DIVISIONS	USCS SYMBOL	TYPICAL DESCRIPTIONS
COARSE GRAINED SOILS (More than half of material is larger than the #4 sieve)	GRAVELS (More than half of coarse fraction is larger than the #4 sieve)	CLEAN GRAVELS WITH LITTLE OR NO FINES GW
		POORLY-GRADED GRAVELS, GRAVEL-SAND MIXTURES WITH LITTLE OR NO FINES GP
	GRAVELS WITH OVER 12% FINES	SILTY GRAVELS, GRAVEL-SILT-SAND MIXTURES GM
		CLAYEY GRAVELS, GRAVEL-SAND-CLAY MIXTURES GC
SANDS (More than half of coarse fraction is smaller than the #4 sieve)	CLEAN SANDS WITH LITTLE OR NO FINES	WELL-GRADED SANDS, SAND-GRAVEL MIXTURES WITH LITTLE OR NO FINES SW
		POORLY-GRADED SANDS, SAND-GRAVEL MIXTURES WITH LITTLE OR NO FINES SP
	SANDS WITH OVER 12% FINES	SILTY SANDS, SAND-GRAVEL-SILT MIXTURES SM
		CLAYEY SANDS SAND-GRAVEL-CLAY MIXTURES SC
FINE GRAINED SOILS (More than half of material is smaller than the #200 sieve)	SILTS AND CLAYS (Liquid limit less than 50)	INORGANIC SILTS & VERY FINE SANDS, SILTY OR CLAYEY FINE SANDS, CLAYEY SILTS WITH SLIGHT PLASTICITY ML
		INORGANIC CLAYS OF LOW TO MEDIUM PLASTICITY, GRAVELLY CLAYS, SANDY CLAYS, SILTY CLAYS, LEAN CLAYS CL
		ORGANIC SILTS & ORGANIC SILTY CLAYS OF LOW PLASTICITY OL
	SILTS AND CLAYS (Liquid limit greater than 50)	INORGANIC SILTS, MICACEOUS OR DIATOMACEOUS FINE SAND OR SILT MH
		INORGANIC CLAYS OF HIGH PLASTICITY, FAT CLAYS CH
		ORGANIC CLAYS & ORGANIC SILTS OF MEDIUM-TO-HIGH PLASTICITY OH
HIGHLY ORGANIC SOILS	PEAT, HUMUS, SWAMP SOILS WITH HIGH ORGANIC CONTENTS PT	

LOG KEY SYMBOLS

	BORING SAMPLE LOCATION		TEST-PIT SAMPLE LOCATION
	WATER LEVEL (level after completion)		WATER LEVEL (level where first encountered)

CEMENTATION

DESCRIPTION	DESCRIPTION
WEAKLY	CRUMBLES OR BREAKS WITH HANDLING OR SLIGHT FINGER PRESSURE
MODERATELY	CRUMBLES OR BREAKS WITH CONSIDERABLE FINGER PRESSURE
STRONGLY	WILL NOT CRUMBLE OR BREAK WITH FINGER PRESSURE

OTHER TESTS KEY

C	CONSOLIDATION	SA	SIEVE ANALYSIS
AL	ATTERBERG LIMITS	DS	DIRECT SHEAR
UC	UNCONFINED COMPRESSION	T	TRIAXIAL
S	SOLUBILITY	R	RESISTIVITY
O	ORGANIC CONTENT	RV	R-VALUE
CBR	CALIFORNIA BEARING RATIO	SU	SOLUBLE SULFATES
COMP	MOISTURE/DENSITY RELATIONSHIP	PM	PERMEABILITY
CI	CALIFORNIA IMPACT	-200	% FINER THAN #200
COL	COLLAPSE POTENTIAL	Gs	SPECIFIC GRAVITY
SS	SHRINK SWELL	SL	SWELL LOAD

MODIFIERS

DESCRIPTION	%
TRACE	<5
SOME	5 - 12
WITH	>12

MOISTURE CONTENT

DESCRIPTION	FIELD TEST
DRY	ABSENCE OF MOISTURE, DUSTY, DRY TO THE TOUCH
MOIST	DAMP BUT NO VISIBLE WATER
WET	VISIBLE FREE WATER, USUALLY SOIL BELOW WATER TABLE

STRATIFICATION

DESCRIPTION	THICKNESS	DESCRIPTION	THICKNESS
SEAM	1/16 - 1/2"	OCCASIONAL	ONE OR LESS PER FOOT OF THICKNESS
LAYER	1/2 - 12"	FREQUENT	MORE THAN ONE PER FOOT OF THICKNESS

GENERAL NOTES

- Lines separating strata on the logs represent approximate boundaries only. Actual transitions may be gradual.
- No warranty is provided as to the continuity of soil conditions between individual sample locations.
- Logs represent general soil conditions observed at the point of exploration on the date indicated.
- In general, Unified Soil Classification designations presented on the logs were evaluated by visual methods only. Therefore, actual designations (based on laboratory tests) may vary.

APPARENT / RELATIVE DENSITY - COARSE-GRAINED SOIL

APPARENT DENSITY	SPT (blows/ft)	MODIFIED CA. SAMPLER (blows/ft)	CALIFORNIA SAMPLER (blows/ft)	RELATIVE DENSITY (%)	FIELD TEST
VERY LOOSE	<4	<4	<5	0 - 15	EASILY PENETRATED WITH 1/2-INCH REINFORCING ROD PUSHED BY HAND
LOOSE	4 - 10	5 - 12	5 - 15	15 - 35	DIFFICULT TO PENETRATE WITH 1/2-INCH REINFORCING ROD PUSHED BY HAND
MEDIUM DENSE	10 - 30	12 - 35	15 - 40	35 - 65	EASILY PENETRATED A FOOT WITH 1/2-INCH REINFORCING ROD DRIVEN WITH 5-LB HAMMER
DENSE	30 - 50	35 - 60	40 - 70	65 - 85	DIFFICULT TO PENETRATED A FOOT WITH 1/2-INCH REINFORCING ROD DRIVEN WITH 5-LB HAMMER
VERY DENSE	>50	>60	>70	85 - 100	PENETRATED ONLY A FEW INCHES WITH 1/2-INCH REINFORCING ROD DRIVEN WITH 5-LB HAMMER

CONSISTENCY - FINE-GRAINED SOIL

CONSISTENCY	SPT (blows/ft)	TORVANE UNTRAINED SHEAR STRENGTH (tsf)	POCKET PENETROMETER UNCONFINED COMPRESSIVE STRENGTH (tsf)	FIELD TEST
VERY SOFT	<2	<0.125	<0.25	EASILY PENETRATED SEVERAL INCHES BY THUMB. EXUDES BETWEEN THUMB AND FINGERS WHEN SQUEEZED BY HAND.
SOFT	2 - 4	0.125 - 0.25	0.25 - 0.5	EASILY PENETRATED ONE INCH BY THUMB. MOLDED BY LIGHT FINGER PRESSURE.
MEDIUM STIFF	4 - 8	0.25 - 0.5	0.5 - 1.0	PENETRATED OVER 1/2 INCH BY THUMB WITH MODERATE EFFORT. MOLDED BY STRONG FINGER PRESSURE.
STIFF	8 - 15	0.5 - 1.0	1.0 - 2.0	INDENTED ABOUT 1/2 INCH BY THUMB BUT PENETRATED ONLY WITH GREAT EFFORT.
VERY STIFF	15 - 30	1.0 - 2.0	2.0 - 4.0	READILY INDENTED BY THUMBNAIL.
HARD	>30	>2.0	>4.0	INDENTED WITH DIFFICULTY BY THUMBNAIL.



Key to Soil Symbols and Terminology

Figure
A-4

APPENDIX B

Liquid Limit, Plastic Limit, and Plasticity Index of Soils

(ASTM D4318)



© IGES 2004, 2014

Project: GTI - Powder Mountain Resort

No: 01628-006

Location: Weber County, Utah

Date: 7/31/2014

By: BRR

Boring No.:

Sample: Lot 77 TP1

Depth: 5.5'

Description: Reddish brown lean clay

Preparation method: Wet
Liquid limit test method: Multipoint



Plastic Limit

Determination No	1	2			
Wet Soil + Tare (g)	32.75	31.90			
Dry Soil + Tare (g)	31.08	30.39			
Water Loss (g)	1.67	1.51			
Tare (g)	21.93	21.95			
Dry Soil (g)	9.15	8.44			
Water Content, w (%)	18.25	17.89			

Liquid Limit

Determination No	1	2	3		
Number of Drops, N	29	22	16		
Wet Soil + Tare (g)	30.93	30.61	31.00		
Dry Soil + Tare (g)	28.75	28.42	28.60		
Water Loss (g)	2.18	2.19	2.40		
Tare (g)	21.96	22.06	21.93		
Dry Soil (g)	6.79	6.36	6.67		
Water Content, w (%)	32.11	34.43	35.98		
One-Point LL (%)	33	34			

Liquid Limit, LL (%)	33
Plastic Limit, PL (%)	18
Plasticity Index, PI (%)	15

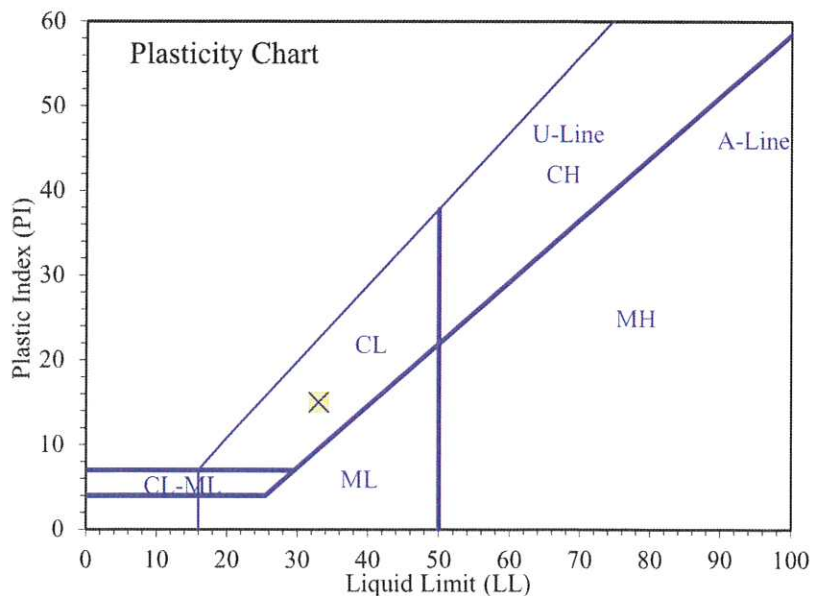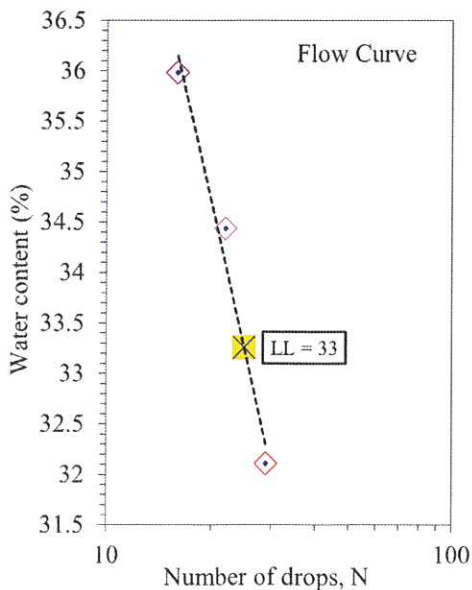

Entered by: _____
Reviewed: _____

Amount of Material in Soil Finer than the No. 200 (75µm) Sieve

(ASTM D1140)



© IGES 2010, 2014

Project: GTI - Powder Mountain Resort

No: 01628-006

Location: Weber County, Utah

Date: 7/30/2014

By: MP

Sample Info.	Boring No.								
	Sample	Lot 77 TPI							
	Depth	5.5'							
	Split	No							
	Split Sieve*								
	Method	A							
Moist total sample wt. (g)		1616.02							
Moist coarse fraction (g)									
Moist split fraction + tare (g)									
Split fraction tare (g)									
Dry split fraction (g)									
Dry retained No. 200 + tare (g)		1242.13							
Wash tare (g)		331.49							
No. 200 Dry wt. retained (g)		910.64							
Split sieve* Dry wt. retained (g)									
Dry total sample wt. (g)		1459.78							
Coarse Fraction	Moist soil + tare (g)								
	Dry soil + tare (g)								
	Tare (g)								
	Water content (%)								
Split Fraction	Moist soil + tare (g)	1947.51							
	Dry soil + tare (g)	1791.27							
	Tare (g)	331.49							
	Water content (%)	10.70							
Percent passing split sieve* (%)									
Percent passing No. 200 sieve (%)		37.6							

Entered by: _____

Reviewed: _____

Minimum Laboratory Soil Resistivity, pH of Soil for Use in Corrosion Testing, and

Ions in Water by Chemically Suppressed Ion Chromatography (AASHTO T 288, T 289, ASTM D4327, and C1580)

Project: GTI - Powder Mountain Resort

No: 01628-006

Location: Weber County, Utah

Date: 8/5/2014

By: ET

Sample info.	Boring No.				
	Sample	Lot 77 TP1			
	Depth	5.5'			
Water content data	Wet soil + tare (g)	142.87			
	Dry soil + tare (g)	130.64			
	Tare (g)	37.62			
	Water content (%)	13.1			
Chem. data	pH	6.48			
	Soluble chloride* (ppm)	3.3			
	Soluble sulfate** (ppm)	7			
Resistivity data	Pin method	2			
	Soil box	Miller Small			
		Approximate Soil condition (%)	Resistance Reading (Ω)	Soil Box Multiplier (cm)	Resistivity (Ω-cm)
		As Is	17710	0.67	11866
		+3	10270	0.67	6881
		+6	9960	0.67	6673
		+9	10670	0.67	7149
		Minimum resistivity (Ω-cm)	6673		

* Performed by AWAL using EPA 300.0

** Performed by AWAL using ASTM C1580

Comments:

Entered by: _____

Reviewed: _____

APPENDIX C

USGS Design Maps Summary Report

User-Specified Input

Building Code Reference Document 2012 International Building Code
 (which utilizes USGS hazard data available in 2008)

Site Coordinates 41.36257°N, 111.74771°W

Site Soil Classification Site Class C – “Very Dense Soil and Soft Rock”



Risk Category I/II/III



USGS-Provided Output

$S_s = 0.813 \text{ g}$	$S_{MS} = 0.874 \text{ g}$	$S_{DS} = 0.583 \text{ g}$
$S_1 = 0.270 \text{ g}$	$S_{M1} = 0.413 \text{ g}$	$S_{D1} = 0.275 \text{ g}$

For information on how the S_s and S_1 values above have been calculated from probabilistic (risk-targeted) and deterministic ground motions in the direction of maximum horizontal response, please return to the application and select the “2009 NEHRP” building code reference document.

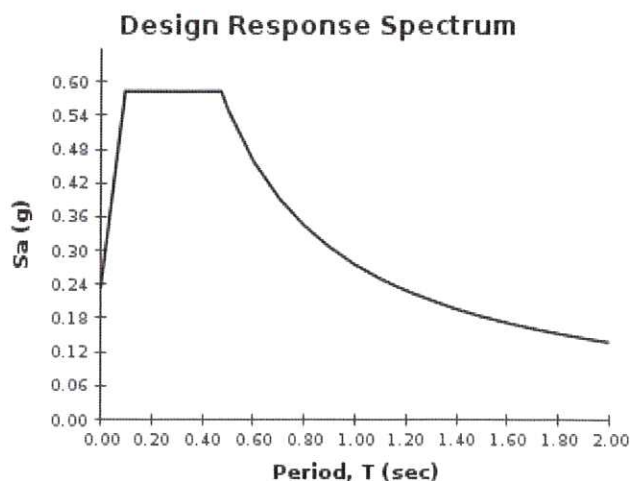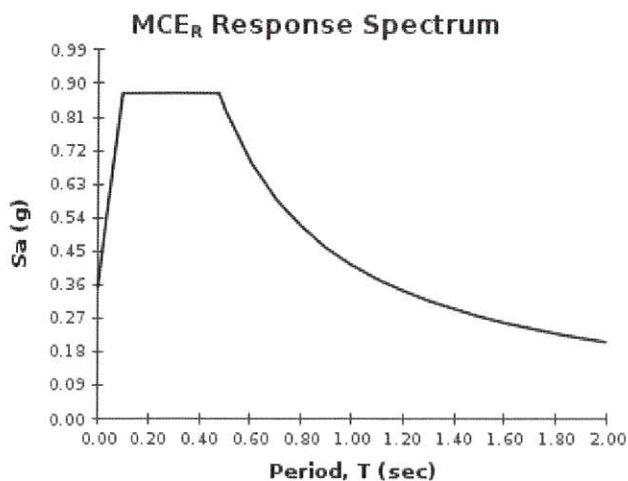

Although this information is a product of the U.S. Geological Survey, we provide no warranty, expressed or implied, as to the accuracy of the data contained therein. This tool is not a substitute for technical subject-matter knowledge.


Design Maps Detailed Report

2012 International Building Code (41.36257°N, 111.74771°W)

Site Class C – “Very Dense Soil and Soft Rock”, Risk Category I/II/III

Section 1613.3.1 — Mapped acceleration parameters

Note: Ground motion values provided below are for the direction of maximum horizontal spectral response acceleration. They have been converted from corresponding geometric mean ground motions computed by the USGS by applying factors of 1.1 (to obtain S_s) and 1.3 (to obtain S_1). Maps in the 2012 International Building Code are provided for Site Class B. Adjustments for other Site Classes are made, as needed, in Section 1613.3.3.

From [Figure 1613.3.1\(1\)](#) ^[1] $S_s = 0.813 \text{ g}$ **From [Figure 1613.3.1\(2\)](#) ^[2]** $S_1 = 0.270 \text{ g}$ **Section 1613.3.2 — Site class definitions**

The authority having jurisdiction (not the USGS), site-specific geotechnical data, and/or the default has classified the site as Site Class C, based on the site soil properties in accordance with Section 1613.

2010 ASCE-7 Standard – Table 20.3-1
SITE CLASS DEFINITIONS

Site Class	\bar{v}_s	\bar{N} or \bar{N}_{ch}	\bar{s}_u
A. Hard Rock	>5,000 ft/s	N/A	N/A
B. Rock	2,500 to 5,000 ft/s	N/A	N/A
C. Very dense soil and soft rock	1,200 to 2,500 ft/s	>50	>2,000 psf
D. Stiff Soil	600 to 1,200 ft/s	15 to 50	1,000 to 2,000 psf
E. Soft clay soil	<600 ft/s	<15	<1,000 psf
Any profile with more than 10 ft of soil having the characteristics:			
<ul style="list-style-type: none"> • Plasticity index $PI > 20$, • Moisture content $w \geq 40\%$, and • Undrained shear strength $\bar{s}_u < 500 \text{ psf}$ 			
F. Soils requiring site response analysis in accordance with Section 21.1	See Section 20.3.1		

For SI: 1ft/s = 0.3048 m/s 1lb/ft² = 0.0479 kN/m²

Section 1613.3.3 — Site coefficients and adjusted maximum considered earthquake spectral response acceleration parameters

TABLE 1613.3.3(1)
VALUES OF SITE COEFFICIENT F_a

Site Class	Mapped Spectral Response Acceleration at Short Period				
	$S_s \leq 0.25$	$S_s = 0.50$	$S_s = 0.75$	$S_s = 1.00$	$S_s \geq 1.25$
A	0.8	0.8	0.8	0.8	0.8
B	1.0	1.0	1.0	1.0	1.0
C	1.2	1.2	1.1	1.0	1.0
D	1.6	1.4	1.2	1.1	1.0
E	2.5	1.7	1.2	0.9	0.9
F	See Section 11.4.7 of ASCE 7				

Note: Use straight-line interpolation for intermediate values of S_s

For Site Class = C and $S_s = 0.813$ g, $F_a = 1.075$

TABLE 1613.3.3(2)
VALUES OF SITE COEFFICIENT F_v

Site Class	Mapped Spectral Response Acceleration at 1-s Period				
	$S_1 \leq 0.10$	$S_1 = 0.20$	$S_1 = 0.30$	$S_1 = 0.40$	$S_1 \geq 0.50$
A	0.8	0.8	0.8	0.8	0.8
B	1.0	1.0	1.0	1.0	1.0
C	1.7	1.6	1.5	1.4	1.3
D	2.4	2.0	1.8	1.6	1.5
E	3.5	3.2	2.8	2.4	2.4
F	See Section 11.4.7 of ASCE 7				

Note: Use straight-line interpolation for intermediate values of S_1

For Site Class = C and $S_1 = 0.270$ g, $F_v = 1.530$

Equation (16-37): $S_{MS} = F_a S_s = 1.075 \times 0.813 = 0.874 \text{ g}$

Equation (16-38): $S_{M1} = F_v S_1 = 1.530 \times 0.270 = 0.413 \text{ g}$

Section 1613.3.4 — Design spectral response acceleration parameters

Equation (16-39): $S_{DS} = \frac{2}{3} S_{MS} = \frac{2}{3} \times 0.874 = 0.583 \text{ g}$

Equation (16-40): $S_{D1} = \frac{2}{3} S_{M1} = \frac{2}{3} \times 0.413 = 0.275 \text{ g}$

Section 1613.3.5 — Determination of seismic design category

TABLE 1613.3.5(1)
SEISMIC DESIGN CATEGORY BASED ON SHORT-PERIOD (0.2 second) RESPONSE
ACCELERATION

VALUE OF S_{DS}	RISK CATEGORY		
	I or II	III	IV
$S_{DS} < 0.167g$	A	A	A
$0.167g \leq S_{DS} < 0.33g$	B	B	C
$0.33g \leq S_{DS} < 0.50g$	C	C	D
$0.50g \leq S_{DS}$	D	D	D

For Risk Category = I and $S_{DS} = 0.583 g$, Seismic Design Category = D

TABLE 1613.3.5(2)
SEISMIC DESIGN CATEGORY BASED ON 1-SECOND PERIOD RESPONSE ACCELERATION

VALUE OF S_{D1}	RISK CATEGORY		
	I or II	III	IV
$S_{D1} < 0.067g$	A	A	A
$0.067g \leq S_{D1} < 0.133g$	B	B	C
$0.133g \leq S_{D1} < 0.20g$	C	C	D
$0.20g \leq S_{D1}$	D	D	D

For Risk Category = I and $S_{D1} = 0.275 g$, Seismic Design Category = D

Note: When S_1 is greater than or equal to 0.75g, the Seismic Design Category is **E** for buildings in Risk Categories I, II, and III, and **F** for those in Risk Category IV, irrespective of the above.

Seismic Design Category \equiv "the more severe design category in accordance with Table 1613.3.5(1) or 1613.3.5(2)" = D

Note: See Section 1613.3.5.1 for alternative approaches to calculating Seismic Design Category.

References

1. Figure 1613.3.1(1): [http://earthquake.usgs.gov/hazards/designmaps/downloads/pdfs/IBC-2012-Fig1613p3p1\(1\).pdf](http://earthquake.usgs.gov/hazards/designmaps/downloads/pdfs/IBC-2012-Fig1613p3p1(1).pdf)
2. Figure 1613.3.1(2): [http://earthquake.usgs.gov/hazards/designmaps/downloads/pdfs/IBC-2012-Fig1613p3p1\(2\).pdf](http://earthquake.usgs.gov/hazards/designmaps/downloads/pdfs/IBC-2012-Fig1613p3p1(2).pdf)

